
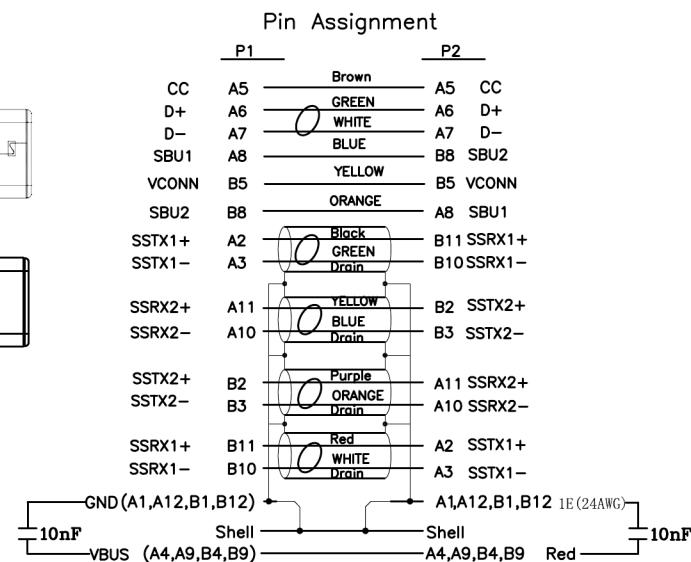
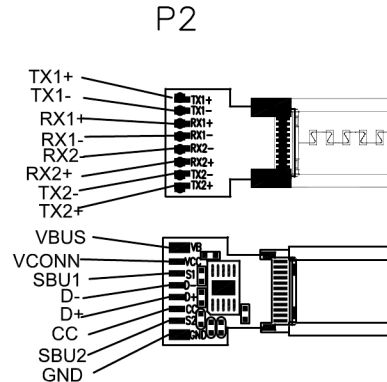
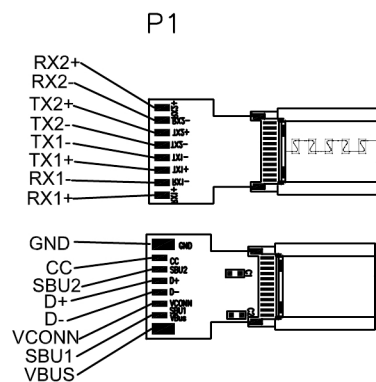


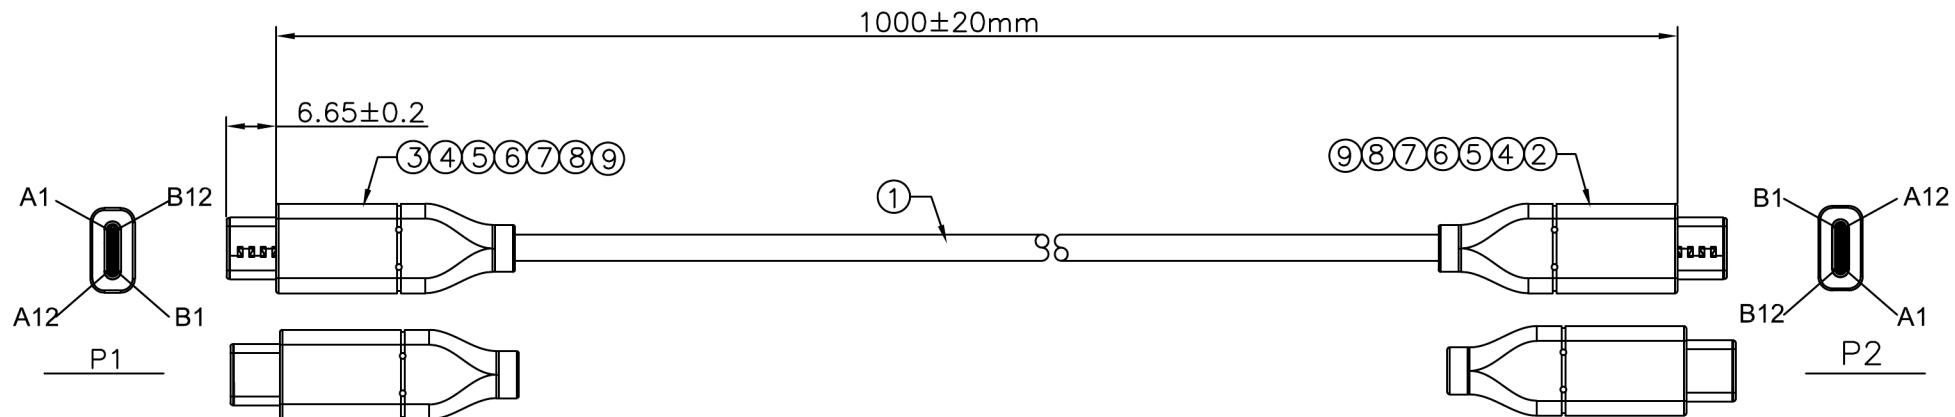

ELECTRICAL TEST:


100% simulated test using computer

9	USB3.1 TYPE C Bottom Shell	1	PCS
8	USB3.1 TYPE C Top Shell	1	PCS
7	USB3.1 TYPE-C Wire clamp Material:NY-66+15%GF	1	PCS
6	OD:2.0mm Black Heat Shrink Tube	0.024	M
5	45P Black PVC	12	G
4	LD-PE TRANSPARENT	3	G
3	USB3.1 C Type Connector With+IC,Terminal PIN GOLD PLATED:G/F,Shell: Ni PLATED	1	PCS
2	USB3.1 C Type Connector With+IC,Terminal PIN GOLD PLATED:G/F,Shell: Ni PLATED	1	PCS
1	USB3.1~[32AWG(7/0.08TC)+EAM]*4P+32AWG(7/0.08TC)*1P+32AWG(7/0.08TC)*4C+24AWG(41/0.08TC)+EAB(16*10/0.08TC 85%TC) OD:4.5MM~UL813 Black	1.02	PCS
NO	DESCRIPTION	Q'TY	UNIT


REV.	ECN No.:	DESCRIPTION	DATE	NAME
		TOLERANCE INCHES M/M		
		.X .015 .30		
		.XX .010 .10		
		.XXX .005 .05		

DRAWN BY	Jerry.Liu	CUSTOMER :	Element 14
CHECK BY		CUSTOMER P/N :	CS28724(PSG91214)
APPD BY		SCALE	NONE
		UNIT	MM
		DATE	15.12.03

TITLE:	USB3.1 CM TO CM(E-Mark) 3A 10G L=1.0M
DRAWING NO.:	
REV.	AO1
	1/2

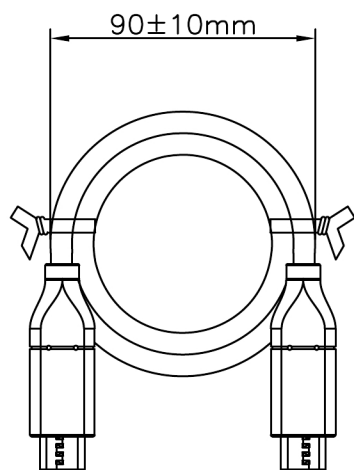


Shipping Mark

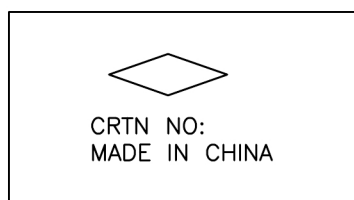


Side Mark

P/O NO.:	
ITEM NO.:	
DESCRIPTION:	
Q'TY	PCS
N.W:	KGS
G.W:	KGS
MEAS:	50X32X21CM

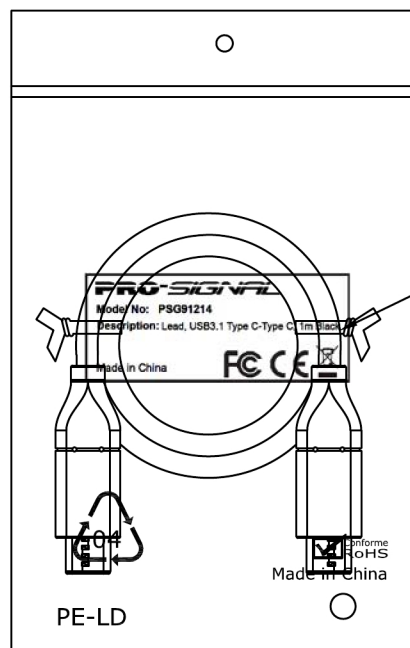

1PCS Packing/Zip-PE BAG

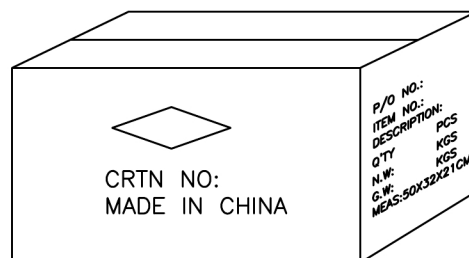

MATTERS NEED ATTENTION:

1. Put a waterproof bag In the carton, Every carton xxxPCS.
2. Top and bottom put a cardboard, sealed by clear tape.

NO		DESCRIPTION	Q'TY	UNIT
6	Label	black type on White Label Size:50*20mm	1	PCS
5	Waterproof	Waterproof Bag:850*750*0.06MM	1/xxx	PCS
4	Pasteboard	Pasteboard:480*300MM B3C	2/xxx	PCS
3	Carton	Carton Size:50X32X21CM K=K mark:MCM...	1/xxx	PCS
2	Tie	White Tie(0.9*1.7MM) L=90mm	2	PCS
1	PE Bag	PE Bag SIZE:100*200*0.06mm	1	PCS

REV.	ECN No.:	DESCRIPTION	DATE	NAME
		TOLERANCE INCHES M/M		
.X	.015	.30		
.XX	.010	.10		
.XXX	.005	.05		
DRAWN BY		Jerry.Liu		
CHECK BY				
APPD BY				
		SCALE	NONE	DRAWING NO.:
		UNIT	MM	
		DATE	15.12.03	REV. A01
				2/2

TITLE:
USB3.1 CM TO CM(E-Mark) 3A 10G L=1.0M

CUSTOMER : Element 14
CUSTOMER P/N : CS28724(PSG91214)